



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 30 of 4367 Rcds

Facility ID: # Area 7 Pedestrian Signals

Author: Vaish, B

Keynote 1



Location: Palos Verdes Dr. East & Crest Rd.
Photo # 1

Field Condition	
04.40 - Other - Curb Ramps and Pedestrian Crossings - See Additional Comments	1991 ADAAG -
Existing Condition:	2004 ADAAG -
	2007 CBC -
	Other -

Corrective Action
039 - Operable Parts - Miscellaneous - See Additional Comments
Additional Comments: Provide audible and vibrotactile signal devices.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$4,800
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Keynote 2



Location: Palos Verdes Dr. East & Crest Rd.
Photo # 3

Field Condition	
04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.	1991 ADAAG -
Existing Condition:	2004 ADAAG -
	2007 CBC -
	Other 2005 PROWAG-R306.2

Corrective Action
039 - Operable Parts - Miscellaneous - See Additional Comments
Additional Comments: Provide audible signal device.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$2,400
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	A
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2026
Status	Not Complete As of 05/09/2013
Reported By	



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 30 of 4367 Rcds

Facility ID: # Area 7 Pedestrian Signals

Author: Vaish, B

Keynote 3



Location: Palos Verdes Dr. East & Crest Rd.
Photo # 3

Field Condition

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to indicate the WALK interval.

Existing Condition:

1991 ADAAG	-
2004 ADAAG	-
2007 CBC	-
Other	2005 PROWAG-R306.2

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with compliant vibrotactile signal device at compliant location.

Costs and Funding

Qty ...Of:	1 EA
Total Cost	\$2,400
Funding Received	\$0

Status Update (check one)
 Completed In Progress Not Complete As of _____ By _____

Classification

DOJ Location Type: 1

Use: PV
 Severity: C
 Level of Difficulty: Moderate

Implementation

Plan Nbr: DBB
 Priority:
 Planned Completion: 6/30/2031
 Status: Not Complete As of 05/09/2013
 Reported By:

Keynote 4



Location: Palos Verdes Dr. East & Crest Rd.
Photo # 3

Field Condition

04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2" across in one dimension.

Existing Condition: 1/2" diameter.

1991 ADAAG	-
2004 ADAAG	-
2007 CBC	-
Other	2005 PROWAG-R306.3.3

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 3 for corrective action.

Costs and Funding

Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0

Status Update (check one)
 Completed In Progress Not Complete As of _____ By _____

Classification

DOJ Location Type: 1

Use: PV
 Severity: C
 Level of Difficulty: Moderate

Implementation

Plan Nbr: DBB
 Priority:
 Planned Completion: 6/30/2031
 Status: Not Complete As of 05/09/2013
 Reported By:



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 30 of 4367 Rcds

Facility ID: # Area 7 Pedestrian Signals

Author: Vaish, B

Keynote 5



Field Condition	
04.26A - Pedestrian Signal Device - Location versus Crosswalk Line - Location of pedestrian signal device is not within 5' of crosswalk line.	1991 ADAAG -
Existing Condition: 7'-10" from crosswalk line.	2004 ADAAG -
	2007 CBC -
	Other 2006 Cal MUTCD-Sec. 4E-09, Fig. 4E-2

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Corrective Action
039 - Operable Parts - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 3 for corrective action.

Costs and Funding
Qty ...Of: 1 EA
Total Cost \$0
Funding Received \$0
Status Update (check one)
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____

Implementation
Plan Nbr: DBB
Priority:
Planned Completion 6/30/2031
Status Not Complete As of 05/09/2013
Reported By

Location: Palos Verdes Dr. East & Crest Rd. **Photo #** 1

Keynote 6



Field Condition	
04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)	1991 ADAAG 4.2.4
Existing Condition: 8.4%. 33.735678,-118.333444	2004 ADAAG 305.3; Fig. 305.3
	2007 CBC 1118B.4 item 1
	Other 2005 PROWAG-R306.2.1

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Corrective Action
027 - Site Work - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 7 for corrective action.

Costs and Funding
Qty ...Of: 1 EA
Total Cost \$0
Funding Received \$0
Status Update (check one)
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____

Implementation
Plan Nbr: DBB
Priority:
Planned Completion 6/30/2031
Status Not Complete As of 05/09/2013
Reported By

Location: Palos Verdes Dr. East & Crest Rd. **Photo #** 6



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 30 of 4367 Rcds

Facility ID: # Area 7 Pedestrian Signals

Author: Vaish, B

Keynote 7



Location: Palos Verdes Dr. East & Crest Rd.
Photo # 6

Field Condition	
04.40 - Other - Curb Ramps and Pedestrian Crossings - See Additional Comments	1991 ADAAG -
Existing Condition: Path of travel to pedestrian signal device is not provided.	2004 ADAAG -
	2007 CBC -
	Other -

Corrective Action	
039 - Operable Parts - Miscellaneous - See Additional Comments	
Additional Comments: Recommendation: Remove pedestrian signal device.	

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$600
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	B
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2026
Status	Not Complete As of 05/09/2013
Reported By	

Keynote 8



Location: Palos Verdes Dr. East & Crest Rd.
Photo # 6

Field Condition	
04.32D - Push Button Contrast - Color Coding - The pedestrian signal push button does not contrast visually with its housing or mounting. (i.e., pedestrian signal push button is not identified by color coding immediately above the control button and consisting of a textured horizontal yellow band 2" wide and encircling the pole, and a 1" wide dark border band above and below this yellow band.)	1991 ADAAG -
Existing Condition:	2004 ADAAG -
	2007 CBC 1117B.5.9
	Other 2005 PROWAG-R306.3.3

Corrective Action	
039 - Operable Parts - Miscellaneous - See Additional Comments	
Additional Comments: See Keynote 7 for corrective action.	

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 30 of 4367 Rcds

Facility ID: # Area 7 Pedestrian Signals

Author: Vaish, B

Keynote 9



Location: Palos Verdes Dr. East & Crest Rd.
Photo # 10

Field Condition	04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.	1991 ADAAG -
Existing Condition:		2004 ADAAG -
		2007 CBC -
		Other 2005 PROWAG-R306.2

Corrective Action	039 - Operable Parts - Miscellaneous - See Additional Comments
Additional Comments:	Provide audible signal device.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$2,400
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/>	As of _____ By _____

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	A
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2026
Status Not Complete As of 05/09/2013	
Reported By	

Keynote 10



Location: Palos Verdes Dr. East & Crest Rd.
Photo # 10

Field Condition	04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to indicate the WALK interval.	1991 ADAAG -
Existing Condition:		2004 ADAAG -
		2007 CBC -
		Other 2005 PROWAG-R306.2

Corrective Action	039 - Operable Parts - Miscellaneous - See Additional Comments
Additional Comments:	Replace with vibrotactile signal device.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$2,400
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/>	As of _____ By _____

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status Not Complete As of 05/09/2013	
Reported By	



**City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos**



Reporting: 30 of 4367 Rclds

Facility ID: # Area 7 Pedestrian Signals

Author: Vaish, B

Keynote 11



Location: Palos Verdes Dr. East & Crest Rd.
Photo # 10

Field Condition	
04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2" across in one dimension.	1991 ADAAG -
Existing Condition: 1/2" diameter.	2004 ADAAG -
	2007 CBC -
	Other 2005 PROWAG-R306.3.3

Corrective Action
039 - Operable Parts - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 10 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Keynote 12



Location: Palos Verdes Dr. East & Crest Rd.
Photo # 10

Field Condition	
04.32A - Push Button Operating Effort - The force required to activate operable part(s) of pedestrian signal device exceeds 5 lbs.	1991 ADAAG 4.27.4
Existing Condition: 6 LBF.	2004 ADAAG 309.4
	2007 CBC 1117B.6 item 4
	Other 2005 PROWAG-R306.3.1; R405.4

Corrective Action
039 - Operable Parts - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 10 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 30 of 4367 Rcds

Facility ID: # Area 7 Pedestrian Signals

Author: Vaish, B

Keynote 13



Location: Palos Verdes Dr. East & Crest Rd. **Photo #** 13

Field Condition	
04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)	1991 ADAAG 4.2.4 2004 ADAAG 305.3; Fig. 305.3 2007 CBC 1118B.4 item 1 Other 2005 PROWAG-R306.2.1
Existing Condition: 2.5%.	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	High

Corrective Action	
008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.	
Additional Comments:	

Costs and Funding	
Qty ...Of:	30 SF
Total Cost	\$576
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status Not Complete As of 05/09/2013	
Reported By	

Keynote 14



Location: Palos Verdes Dr. East & Crest Rd. **Photo #** 14

Field Condition	
04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2" across in one dimension.	1991 ADAAG - 2004 ADAAG - 2007 CBC - Other 2005 PROWAG-R306.3.3
Existing Condition: 1/2" diameter.	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Corrective Action	
039 - Operable Parts - Miscellaneous - See Additional Comments	
Additional Comments: See Keynote 16 for corrective action.	

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status Not Complete As of 05/09/2013	
Reported By	



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 30 of 4367 Rcds

Facility ID: # Area 7 Pedestrian Signals

Author: Vaish, B

Keynote 15



Field Condition	
04.26A - Pedestrian Signal Device - Location versus Crosswalk Line - Location of pedestrian signal device is not within 5' of crosswalk line.	1991 ADAAG -
Existing Condition: 7'-4" from crosswalk line.	2004 ADAAG -
	2007 CBC -
	Other 2006 Cal MUTCD-Sec. 4E-09, Fig. 4E-2

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Corrective Action
039 - Operable Parts - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 16 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Location: Palos Verdes Dr. East & Crest Rd. **Photo #** 15

Keynote 16



Field Condition	
04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to indicate the WALK interval.	1991 ADAAG -
Existing Condition:	2004 ADAAG -
	2007 CBC -
	Other 2005 PROWAG-R306.2

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Corrective Action
039 - Operable Parts - Miscellaneous - See Additional Comments
Additional Comments: Replace with vibrotactile signal device.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$2,400
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Location: Palos Verdes Dr. East & Crest Rd. **Photo #** 14



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 30 of 4367 Rcds

Facility ID: # Area 7 Pedestrian Signals

Author: Vaish, B

Keynote 17



Field Condition	
04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.	1991 ADAAG -
Existing Condition:	2004 ADAAG -
	2007 CBC -
	Other 2005 PROWAG-R306.2

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Corrective Action
039 - Operable Parts - Miscellaneous - See Additional Comments
Additional Comments: Provide audible signal device.

Costs and Funding
Qty ...Of: 1 EA
Total Cost \$2,400
Funding Received \$0
Status Update (check one)
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____

Implementation
Plan Nbr: DBB
Priority:
Planned Completion 6/30/2031
Status Not Complete As of 05/09/2013
Reported By

Location: Palos Verdes Dr. East & Crest Rd. **Photo #** 14

Keynote 18



Field Condition	
04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)	1991 ADAAG 4.2.4
Existing Condition: 2.2% & 2.6%.	2004 ADAAG 305.3; Fig. 305.3
	2007 CBC 1118B.4 item 1
	Other 2005 PROWAG-R306.2.1

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	High

Corrective Action
008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.
Additional Comments:

Costs and Funding
Qty ...Of: 30 SF
Total Cost \$576
Funding Received \$0
Status Update (check one)
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____

Implementation
Plan Nbr: DBB
Priority:
Planned Completion 6/30/2031
Status Not Complete As of 05/09/2013
Reported By

Location: Palos Verdes Dr. East & Crest Rd. **Photo #** 15



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 30 of 4367 Rcds

Facility ID: # Area 7 Pedestrian Signals

Author: Vaish, B

Keynote 19



Field Condition	04.32D - Push Button Contrast - Color Coding - The pedestrian signal push button does not contrast visually with its housing or mounting. (i.e., pedestrian signal push button is not identified by color coding immediately above the control button and consisting of a textured horizontal yellow band 2" wide and encircling the pole, and a 1" wide dark border band above and below this yellow band.)	1991 ADAAG -
		2004 ADAAG -
Existing Condition:		2007 CBC 1117B.5.9
		Other 2005 PROWAG-R306.3.3

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Corrective Action	039 - Operable Parts - Miscellaneous - See Additional Comments
Additional Comments:	See Keynote 20 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/>	As of _____ By _____

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status Not Complete As of 05/09/2013	
Reported By	

Location: Palos Verdes Dr. East & Crest Rd. **Photo #** 19

Keynote 20



Field Condition	04.40 - Other - Curb Ramps and Pedestrian Crossings - See Additional Comments	1991 ADAAG -
		2004 ADAAG -
Existing Condition:	Path of travel to pedestrian signal device is not provided.	2007 CBC -
		Other -

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	B
Level of Difficulty	Moderate

Corrective Action	039 - Operable Parts - Miscellaneous - See Additional Comments
Additional Comments:	Recommendation: Remove pedestrian signal device.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$600
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/>	As of _____ By _____

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2026
Status Not Complete As of 05/09/2013	
Reported By	

Location: Palos Verdes Dr. East & Crest Rd. **Photo #** 20



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 30 of 4367 Rcds

Facility ID: # Area 7 Pedestrian Signals

Author: Vaish, B

Keynote 21



Location: Palos Verdes Dr. East & Crest Rd.
Photo # 21

Field Condition	
04.26A - Pedestrian Signal Device - Location versus Crosswalk Line - Location of pedestrian signal device is not within 5' of crosswalk line.	1991 ADAAG -
Existing Condition: 8'-8" from crosswalk line.	2004 ADAAG -
	2007 CBC -
	Other 2006 Cal MUTCD-Sec. 4E-09, Fig. 4E-2

Corrective Action
039 - Operable Parts - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 25 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Keynote 22



Location: Palos Verdes Dr. East & Crest Rd.
Photo # 19

Field Condition	
04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.	1991 ADAAG -
Existing Condition:	2004 ADAAG -
	2007 CBC -
	Other 2005 PROWAG-R306.2

Corrective Action
039 - Operable Parts - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 20 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	A
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2026
Status	Not Complete As of 05/09/2013
Reported By	



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 30 of 4367 Rcds

Facility ID: # Area 7 Pedestrian Signals

Author: Vaish, B

Keynote 23



Field Condition	
04.32A - Push Button Operating Effort - The force required to activate operable part(s) of pedestrian signal device exceeds 5 lbs.	1991 ADAAG 4.27.4
Existing Condition: 6 LBF.	2004 ADAAG 309.4
	2007 CBC 1117B.6 item 4
	Other 2005 PROWAG-R306.3.1; R405.4

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Corrective Action
039 - Operable Parts - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 25 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status Not Complete As of	05/09/2013
Reported By	

Status Update (check one)
 Completed In Progress Not Complete As of _____ By _____

Location: Palos Verdes Dr. East & Crest Rd. Photo # 23

Keynote 24



Field Condition	
04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2" across in one dimension.	1991 ADAAG -
Existing Condition: 1/2" diameter.	2004 ADAAG -
	2007 CBC -
	Other 2005 PROWAG-R306.3.3

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Corrective Action
039 - Operable Parts - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 25 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status Not Complete As of	05/09/2013
Reported By	

Status Update (check one)
 Completed In Progress Not Complete As of _____ By _____

Location: Palos Verdes Dr. East & Crest Rd. Photo # 23



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 30 of 4367 Rcds

Facility ID: # Area 7 Pedestrian Signals

Author: Vaish, B

Keynote 25



Field Condition

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to indicate the WALK interval.

Existing Condition:

1991 ADAAG	-
2004 ADAAG	-
2007 CBC	-
Other	2005 PROWAG-R306.2

Classification

DOJ Location Type: 1

Use: PV

Severity: C

Level of Difficulty: Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$2,400

Funding Received \$0

Status Update (check one)
 Completed In Progress Not Complete As of _____ By _____

Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Location: Palos Verdes Dr. East & Crest Rd. Photo # 23

Keynote 26



Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

Existing Condition:

1991 ADAAG	-
2004 ADAAG	-
2007 CBC	-
Other	2005 PROWAG-R306.2

Classification

DOJ Location Type: 1

Use: PV

Severity: C

Level of Difficulty: Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$2,400

Funding Received \$0

Status Update (check one)
 Completed In Progress Not Complete As of _____ By _____

Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Location: Palos Verdes Dr. East & Crest Rd. Photo # 23



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 30 of 4367 Rcds

Facility ID: # Area 7 Pedestrian Signals

Author: Vaish, B

Keynote 27



Location: Palos Verdes Dr. East & Crest Rd.
Photo # 27

Field Condition	
04.40 - Other - Curb Ramps and Pedestrian Crossings - See Additional Comments	1991 ADAAG -
Existing Condition:	2004 ADAAG -
	2007 CBC -
	Other -

Corrective Action	
039 - Operable Parts - Miscellaneous - See Additional Comments	
Additional Comments: Provide audible and vibrotactile signal device.	

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$4,800
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Keynote 28



Location: Palos Verdes Dr. East & Crest Rd.
Photo # 19

Field Condition	
04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to indicate the WALK interval.	1991 ADAAG -
Existing Condition:	2004 ADAAG -
	2007 CBC -
	Other 2005 PROWAG-R306.2

Corrective Action	
039 - Operable Parts - Miscellaneous - See Additional Comments	
Additional Comments: See Keynote 20 for corrective action.	

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 30 of 4367 Rcds

Facility ID: # Area 7 Pedestrian Signals

Author: Vaish, B

Keynote 29



Location: Palos Verdes Dr. East & Crest Rd.
Photo # 6

Field Condition	
04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.	1991 ADAAG -
Existing Condition:	2004 ADAAG -
	2007 CBC -
	Other 2005 PROWAG-R306.2

Corrective Action
039 - Operable Parts - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 7 for corrective action.

Costs and Funding
Qty ...Of: 1 EA
Total Cost \$0
Funding Received \$0
Status Update (check one)
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____

Classification
DOJ Location Type: 1
Use: PV
Severity: A
Level of Difficulty Moderate

Implementation
Plan Nbr: DBB
Priority:
Planned Completion 6/30/2026
Status Not Complete As of 05/09/2013
Reported By

Keynote 30



Location: Palos Verdes Dr. East & Crest Rd.
Photo # 6

Field Condition	
04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to indicate the WALK interval.	1991 ADAAG -
Existing Condition:	2004 ADAAG -
	2007 CBC -
	Other 2005 PROWAG-R306.2

Corrective Action
039 - Operable Parts - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 7 for corrective action.

Costs and Funding
Qty ...Of: 1 EA
Total Cost \$0
Funding Received \$0
Status Update (check one)
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____

Classification
DOJ Location Type: 1
Use: PV
Severity: C
Level of Difficulty Moderate

Implementation
Plan Nbr: DBB
Priority:
Planned Completion 6/30/2031
Status Not Complete As of 05/09/2013
Reported By