


TOPOGRAPHIC MAP OF
THE PORTUGUESE BEND LANDSLIDE
SHOWING LOCATIONS OF EXPLORATION
DRILL HOLES, CAISSON INSTALLATION
HOLES, AND GENERALIZED CONTOURS
ON THE ACTIVE FAILURE SURFACE

Failure Surface Contour Interval: 20 feet
Failure surface contours dashed west of
Pepperree Drive where lack of drill hole
data and sparsity of surface fissures
necessitated extrapolation.

DRILL HOLE SYMBOL EXPLANATION

- Polos Verdes Properties 1956-1957
- Donald R. Warren Co 1957
- Coisson installation holes drilled by
Mockintosh & Mockintosh and by Los
Angeles County 1957
- ◆ Polos Verdes Properties 1968-1969

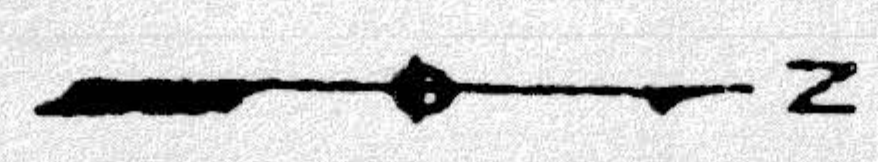

Vertical datum: mean sea level

Surface topography depicted as of 1965

